			UNII Aemate Cantrol Unit (RCU		
FMEA NO. 1.1.8		SHUTTLE CCTV CRITICAL IVEMS LIST	DWG NO. 2294824-506, 507		
CRITICALITY 2/2			SHEET OFB		
FATLURE MODE AND CAUSE	FAILURE EFFECT ON END ITEN	RATIONALE FOR ACCEPTANCE			
		The RCU is a microprocessor-based command and control or microprocessor, CMOS RAM, and TTL PROM. Computer I/O c CHOS CD4000 teries logic to minimize power dissipation dual master oscillator (one active, one cold backup). Temperature Compensated Crystal Oscillator (TCXO) purch specification control drawing (SCO). Decode logic constit, and the sync amplifier design uses monolithic NESS. Parts were required to be JAN reliability lavel parts of selection falls into three categories: (1) JAN or better parts from the Hilitary QPL, (2) Parts demonstrated to NASA to be equivalent to (e.g., CD4000/3W series parts), or (3) Parts procured to an RCA spec control drawing a screening to effect JAN equivalency. BARE BOARD DESIGN (A5) The design for the associated board A5 is constructed for clad epoxy glass sheets (NEMA 6-10) Grade FR-4), PER MCC connections are made through printed traces which run fiboard surfaces. Every trace terminates at an annular of surrounds the hole in which a component lead or terminal provides a footing for the solder, ensuring good mechan performance. Its size and shape are governed by HE-P-spacing and routing. These requirements are reiterated notes to further assure compliance. Variations between final product (due to irregularities of the etching products to further assure compliance. Variations between final product (due to irregularities of the etching produce and elad or terminal, but serve only to electrical board layers, contain stitch bars for mechanical support. The thru hules are drilled from a drill tape thus eliminal magnetant relvability criterion. After drilling and etchin-lead plated per MIL-STD-1495. This provides for eat the time of board assembly, even after periods of prolon.	nit using an RCA 1882 CHOS ircuitry is implemented in The design incorporates a The master oscillator is a ased From Vectron to an RCA 1815 of Low Power Scholtky 39 wideband op amps. I their equivalent. Part JAN level via test data which calls out tests and From point to point on the ing. The annular ring 1 is located. This ring ical and electrical social and electrical social and electrical specifically in drawing the artwork master and the cass) are also controlled by row good arthork. Holes which by interconnect the different and increased reliability. Inating the possibility of nular ring concentricity, an ching, All copper cladding is say and reliable soldering at		
	1				

		KEALZEIL 10-1	
FMEA NO. 1.1.8		SHUTTLE COTV ONG NO. 2294024-506, 507 CRETICAL HEMS LIST SHEET 2 OF 9	_
TAILURE MODE AND CAUSE USS of odd field sync. Board Decodes or Line Drivers On Clack/Nultiburst Assy A5, 2294864-50?, or 2592384-501	FAILURE EFFECT ON END ITEM. Loss of video routing capability in VSU. Morst Case: Loss of mission critical video	RATIONALE FOR ACCEPTANCE OESIGN FRATURES (Continued) BUARD ASSEMBLY DESIGN (AS) All components are installed in a manner which assures maximum reliability. Component leads are pre-tinned, allowing total wetting of solder joints. All leads are formed to provide stress relief and the bodies of large components are staked. Special mounting and handling instructions are included in each drawing required after final assembly. The board is coated with wrethane which protects against homidity and contamination. BOARD PLACEMENT The boards are secured in the electronics assembly by gold—plated beryllium copper card guides. Connections are made to the mother board with blind-mated connectors. Disengagement during launch is prevented by a cover which spans the board's free edge.	₽.
	1	1	

FMEA NO. 1_1.8 CHITICALITY 2/2		SINITICE COTY CRITICAL ITEMS LEST	UNIT Remote Control Unit (RCU) DWG NO. 2294924-596, 507 SHEET 3 OF _8
FAILURE MODE AND CAUSE Sess of odd field sync. Doard Decodes or Line Drivers on Clock/Multiburst Assy A5, 2294064-502, or 2592384-501	FAILURE EFFECT ON END ITEM Loss of video routing capability in VSU. Morst Case: Loss of mission critical video	RATIONALE FOR ACCEPTANC QUALIFICATION TEST For Qualification Test flow, see Yable 2 located at the	<u> </u>

•			NEVISED 10-14-86	
FMEA NO. 1,1,28		SHUTTLE CCTV CRITICAL TIEMS LIST	UNIT Remote Control Unit (RCU) DHG NO. 2294824-506, 507 SHEET 4 0F 8	
CRITICALITY 2/2			30000	
FA]LURE MODE AND CAUSE	FAILURE EFFECT ON END ITEM	RATIONALE FOR ACCEPTANCE		
nuse: Board Decodes or Line Drivers on Clock/Hultiburst Assy A5, 2294864-502, or 2592384-501	Loss of video routing capability in VSU. Worst Case: Loss of mission critical video	ACCEPTANCE TEST The CCTV systems' RCU is subjected to the followi Vibration: 20-80Hz: 3 dB/Ogt-rise fro 80-350 Hz: 0.04 G/Hz 350-750 Hz: 3 dB/Ogt-fall to 750-1000: 0.018 G/Hz 1000-2000: 3 dB/Oct-fall to 16st Duration: 1 Hinute per Axis fest level: 6.6 Grms Thermal: 100° F: Time to stablize equipme 10° F: Jime to stablize equipme 10° F: Jime to stablize equipme 100° F: Time to stablize equipme 100° F: Time to stablize equipme 100° F: Time to stablize equipme 100° F: Jime to stablize equipme 100° Jime to stablize equipme 100° F: Jime to stablize equipme 100° Jime	an 0.01 62/Hz to 0.04 62/Hz 0.018 62/Hz 0.009 62/Hz at plus 1 hour at plus 1 hour at plus 1 hour the front of this book. Lie front of this book. tional, a test must verify the the PHS (A7A1) panel switch, mera/PTU, to the Camera/PTU command ability to produce video, the VSU's to display video. A similar test estimation and the camera under panel. e that if video on monitor is this indicates that the camera and that the camera is producing manacommands and visually (either erify operation. a under test as source. panel. meands via the HDH command path.	

FMEA NO. [.:.8 CRITICALITY 2/2		SHOTTLE CCTV CRITICAL ITEMS LIST	UNIT Remote Control Unit (8CU) DWG NO. <u>2294824-506, 507</u>
		ERTITORE TIENS ETS!	\$HEET <u>5</u> OF <u>B</u>
FAILURE MODE AND CAUSE	FAILURE EFFECT ON END LIEN	RATIONALE FOR ACCEPTANCE	
CAUSE See: Hoard Decodes or Line Orivers on Clock/Multiburst Assy A5, 2294864-502, or 2592384-501	ON EMP (TEM Loss of video routing capability in VSU. Horst Case: Loss of mission critical video	Procurement Control - The RCU EEE parts and hardware it vendors and suppliers, which meet the requirements set and Quality Plan Work Statement (NS-2593176). Resident procurement documents to establish the need for GSI on Incoming Inspection and Storage - Incoming Quality inspectived materials and parts. Results are recorded by drawing and control numbers for future reference and trisubjected to incoming acceptance tests as called for in Inspection Test Instructions. Incoming flight parts are accordance with RCA 1846684 - Preconditioning and Accepted technology at them are inspected per PAI 316 - Incoming Hechanical items are inspected per PAI 316 - Incoming Hechanical items, PAI 305 - Incoming Quality Control In PAI 612 - Procedure for Processing Incoming or Purchase Use. Accepted items are delivered to Material Controll specified conditions until fabrication is required. Monheld for Material Review Board (MRB) disposition. (PAI Board Assembly & Iest - Prior to the start of RCU board verified to be correct by stock room personnel, as the a kil. The items are verified again by the operator who checking against the as-built-parts-list (ABPL). OCAS I are designated for printed circuit, wire wrap and weldeconnectors for soldering wiring, crimping, solder split prior to coating of the component side of boards and sil Specific RCU board assembly and test instructions are pnotes, and applicable documents are called out in the Fland Record (FPR-2294824) and parts list PL-2294824. The List 2295901, Process Standard RIV-566 226088), Process Tape 2280889, Specification — Urethone coating 2280877, Specification — Workmanship 8030035, Specification Bond RCU Assembly and Test — An open box test is performed pnaceptance Test per TP-AI-2294824, including vibration are specified and witnessed, traceability numbers are rare chacked prior to use. RCA Quality and BCAS inspection of specified FPR operations in accordance with and PAI 217. DEAS personnel witness RCU button-up and	ems are procured from approved forth in the CCIV contract DCAS personnel review all selected parts (PAI 517). ections are made on all lot and retained in file by aceability. All EEE parts are PAI 315 - Incoming e further processed in tance Requirements for testing is not performed. Instructions for spection instruction, and d Parts Designated for Flight ed Stores and retained under monforming materials are -307, PAI IQC-531.} assembly, all items are items are accomplated to form a dassembles the kit by Mandatory Enspection Points d wire boards, plus harness es and quality workmanship eeving of harnesses. rovided in drawing abrication Procedure ese include wire connections Standard - Bonding Velcro ation Name Plate Application n - Bonding and Staking ification - Locking Compound ation - Marking 2280876, ing and Staking 2200075. er IP-IT-2294824, and an and thermal-vacuum. Torques ecorded, and calibrated tools ions are performed at the the PAI-204, PAI-205, PAI-206.
	1	,	,

678

		REVISED 10-14			
FMEA NO. 1.1.8		SHUTTLE CCTV CRIFICAL ITEMS LIST	UNIT Remote Control Unit (9CU) DWG NO. 2294824-506, 507 SHEET <u>6</u> OF <u>8</u>		
FAILURE HODE AND CAUSE OSS of odd field sync. Souse: Stoard Decodes or Line Orivers on Clock/Multiburst Assy A5, 2294864-502 or 2592384-501 FAILURE EFFECT ON END TIEM Loss of video routing capability in VSU. Moral Case: Souse of mission critical video		QA/INSPECTION (Continued) OCAS personnel monitor acceptance tests and review the personnel also inspect for conformance after all repair standard for Packaging and Handling guidelines. All reassembly drawings, Parts List, ABPt, Test Data, etc., documentation folder assigned specifically to each assign reference. An EIDP is prepared for each RCU in according, and review the EIDP for completeness and according.	test data/results. These r, rework and retest. ng to 2280746, Process elated documentation including is gathered and held in a embly. This folder is retained cordance with the requirements ing, packaging, packing and		
-					

FMCA NO. 1.1.8		SHUTTLE COTV CRITICAL ITEMS LIST		UNII Remote Control Unit (8CU) DWG ND. 2294824-506, 507	
				SHEET7 OF8	
FAILURE MODE AND CAUSE	FATLURE EFFECT ON END ITEM		RATIONALE FOR ACCEPTAN	GE	
oss of odd field sync. lause: Board Decodes or time Drivers on Clock/Multiburst Assy A5, 2294864-502 or 2592304-501	Loss of video routing capability in VSU. Worst Case: Loss of mission critical video	FAILURE HISTORY NONE.			
•			•	·	
			·		
		(

FME'A NO. 1.1.8		SHUITLE CCTV ERITICAL TIEMS LIST	UNIT Remote Control Unit (RCU) DWG NO. 2294824-506, 507 SHEET 8 OF 8
talibre MODE AND CAUSE Doss of odd field synt. Board Occodes or Line Drivers on Clock/Multiburst Assy A5, 2294864-582 or 2592384-501	FAILURE EFFECT ON END ITEM Loss of video routing capability in VSU. Worst Case: Loss of mission critical video	PERATIONAL EFFECTS Loss of video. Possible loss of major mission objur other required cameras. CHEW ACTIONS If possible, continue RMS operations using alternative TRAINING Crew should be trained to use possible alternative MISSION CONSTRAINI Where possible, procedures should be designed so to ECIV.	ectives due to loss of RMS cameros tive visual cues. s to CCTV.